

120+ Locations in 19 states, mhc.com

REQUEST FOR PO

Customer Number:

SERVICING DEALERSHIP

SOUTHWEST STERLING, LLC, DBA

MHC KENWORTH/FORD - EL PASO 10901 GATEWAY WEST EL PASO, TX 79935 1-915-593-2641

R. O.	Number:	R00653700286039

Tax Status	Terms	P.O.#	Service Da	0/4 = /2000
RES	CHARGE	REQUIRED	5/25/202	2 0/10/2022

(325) 692-8000

Phone:

MHC Kenworth Abilene 518 S Access Rd PO Box 509 Tye TX 79563-2336

196976

REQUEST FOR PO

		Make / Model	Year	License Number Mileage
Serial Number	Unit Number		2017	702901
1XKWD49X4HJ169230	500927	Kenworth/W900	2017	

OPERATION

COMPLAINT: VEHICLE INSPECTION VMRS CODE: 05-999-999-999-06-00

CORRECTION: INSPECT-TOTAL VEHICLE-TOTAL VEHICLE-NO FAILURE

Labor Total --Total Operation

OPERATION 2

COMPLAINT: LOST OIL PRESSUE, JUST HAD OVERHEAD VMRS CODE: 01-999-999-000-09-00

VMRS CODE:

TROUBLESHOOTING-TOTAL VEHICLE-TOTAL VEHICLE-NO FAILURE CORRECTION:

-CONNECTED TO ENGINE ECM THROUGH INSITE (CART-20) -SAVED IMAGES TO W:

-ACTIVE FAULTS:

143 @ 2 COUNTS / 3 HRS AGO

-LOGGED FAULTS:

COUNTS / 3 HRS AGO

-CONNECTED MECHANICAL GAUGE AND CRANKED UNIT -MEASURED OPSI AT MECHANICAL GAUGE AND INSITE

-DRAINED OIL

-FOUND MINOR METAL SHAVINGS ON OIL

-REMOVED OIL PAN

-FOUND STIFFENER PLATE AND BOLTS INSIDE PAN

-FOUND P/U TUBE LAYING IN PAN -REMOVED 3/4/5 MAIN BEARING CAPS

-FOUND LIGHT SCRATCHING ON MB CAPS AND CRANK -REMOVED OIL PUMP

-NEED TO OPEN AND INSPECT O/PUMP AND 3/4 ROD BEARINGS -PARTS SITTING ON LEFT SIDE OF TRUCK DISASSEMBLED OIL PUMP

AND FOUND SCORING ON HOUSING, GEARS AND PRESSURE RELIEF VALVE, REMOVED #2 ROD CAP AND FOUND SAME DAMAGE AS CRANK,

REMOVED OIL FILTER AND FOUND METAL IN OIL, MADE ESTIMATE FOR NEW ROD BEARINGS, MAIN BEARINGS, PISTON COOLING NOZZLES, OIL

CONTINUED



120+ Locations in 19 states, mhc.com

SERVICING DEALERSHIP

R00653700286

SOUTHWEST STERLING, LLC, DBA

MHC KENWORTH/FORD - EL PASO 10901 GATEWAY WEST EL PASO, TX 79935 1-915-593-2641

REQUEST FOR PO

	REQUEST	FOR PO	2000	R. O. Number:	R0065370026
	Customer Numb	ber: 196976	Phone: (325) 692-8000	Service Date	Date Print
	Tax Status	Terms	P.O.#	5/25/2022	6/15/20
Ī	RFS	CHARGE	REQUIRED		

OPERATION

COOLER AND OIL PUMP. -CONTINUED REPAIRS
-CUT OPEN OIL FILTER AND INSPECTED FOR METAL DEBRIS
-METAL DEBRIS WAS PRESENT

-QUOTED ADDITIONAL PARTS FOR REPAIRS (OIL COOLER, OIL COOLER THERMOSTAT AND RELATED GASKETS

-KEMOVED OIL PAN
-REPLACED MAIN AND ROD BEARINGS
-TORQUED ROD CAP BOLTS (52 LBFT + 60*)
-TORQUED MAIN CAP BOLTS (110 LBFT + 180*)
-TORQUED MAIN CAP BOLTS (110 LBFT + 0UT
-PLACED OIL PAN BACK ON TO KEEP DIRT OUT
-PLACED REMAINING PARTS RECEIVED IN DRIVER SIDE OF CAB
-PLACED REMAINING PARTS RECEIVED IN DRIVER SIDE OF CAB
-PLACED REMAINING PARTS RECEIVED IN DRIVER OF CAB -TORQUED MAIN ON TO KEEP DIRT OUT
-PLACED OIL PAN BACK ON TO KEEP DIRT OUT
-PLACED REMAINING PARTS RECEIVED IN DRIVER SIDE OF CAB
-PLACED REMAINING PARTS RECEIVED IN DRIVER SIDE OF CAB
-PLACED REMAINING PARTS RECEIVED IN DRIVER SIDE OF CAB
-PLACED REMAINING PARTS RECEIVED IN DRIVER SIDE OF CAB
-PLACED REMAINING PARTS RECEIVED IN DRIVER SIDE OF CAB
-PLACED REMAINING PARTS RECEIVED IN DRIVER SIDE OF CAB
WITH SHIMS AND TORQUED OIL PUMP BOLTS TO 41 FTLBS, CLEANED
WITH SHIMS AND TORQUED BOLTS, INSTALLED PLAKE
TO 50 FT LBS AND THEN ADDITIONAL 60 DEGREES, INSTALLED PICK
TO 50 FT LBS AND TORQUED BOLTS TO 35 FT LBS, NEED TO INSTALL OIL
PAN WITH NEW GASKET DUE TO OLD ONE BEING DAMAGED LEFT ALL
PAN WITH NEW GASKET DUE TO OLD ONE BEING DAMAGED LEFT ALL
PAN WITH NEW GASKET AND REPLACE COOLING NOZZLES,
NEED TO REMOVED STIFFENER PLATE AND INSTALL OIL PAN, TRUCK ALSO NEEDS
AND RE INSTALL PLATE AND INSTALL OIL PAN, TRUCK REMOVED
OIL COOLER REPLACED, LEFT OIL COOLER INSIDE TRUCK REMOVED
OIL COOLER REPLACED, LEFT OIL COOLER INSIDE TRUCK REMOVED
STIFFENER PLATE, REPLACED ALL 6 OIL COOLING NOZZLES AND
TORQUED TO 48 FTLBS, THEN INSTALLED STIFFENER PLATE AND
TORQUED DOWN BOLTS TO 50 FTLBS AND 60 DEGREES FINAL STEP,
INSTALLED OIL PAN WITH NEW GASKET AND APPLIED SILICONE TO 4
CORNER OF BLOCK, TORQUED BOLTS TO 41 FTLBS. NEED TO FILL
ENGINE WITH OIL. DRAINED COOLANT, REMOVED AIR FILTER
PIPING, CAC PIPES, EXHAUST DOWN PIPE, TURBO COOLANT LINES
AND ELECTRICAL CONNECTORS, TURBO OIL DRAIN, REMOVED
TURBOCHARGER, REMOVED EGR COOLER, OIL COOLER PLATE,
INSTALLED NEW OIL COOLER AND TORQUED TO 20 NM, CLEANED OIL
THERMOSTAT AND REINSTALLED IT, INSTALLED OIL COOLER PLATE
WITH NEW GASKET AND TORQUED TO 20 NM, CLEANED OIL
WITH NEW GASKET AND TORQUED TO 20 NM, CLEANED OIL THERMOSTAT AND REINSTALLED IT, INSTALLED OIL COOLER PLATE
WITH NEW GASKET AND TORQUED TO 35 FTLBS, EGR COOLER, AND
TURBOCHARGER WITH FRESH GASKETS AND O RINGS, NEED TO INSTALL
DOWN PIPE, CAC PIPING, EGR COOLER COOLANT LINE, CONNECT
ELECTRICAL CONNECTOR, FILL ENGINE WITH OIL AND COOLANT
INSTALLED EXHAUST DOWNDIDE CAC BIBLIOG ZIBTIED ELECTRICAL INSTALLED EXHAUST DOWNPIPE, CAC PIPING, ZIPTIED ELECTRICAL CONNECTORS, FILLED ENGINE WITH OIL AND FILLED COOLING SYSTEM, INSTALLED DRIVELINE WITH NEW BOLTS AND TORQUED TO 125 FTLBS, CLEARED CODES, STARTED REGEN AND FINISHED SUCCESSFULLY NEEDS ROADTEST. Labor Total --



CHARGE

REQUIRED

120+ Locations in 19 states, mhc.com

REQUEST FOR PO

RES

SERVICING DEALERSHIP

SOUTHWEST STERLING, LLC, DBA

MHC KENWORTH/FORD - EL PASO 10901 GATEWAY WEST EL PASO, TX 79935 1-915-593-2641

5/25/2022

6/15/2022

Customer Number:	196976	Phone:	(325) 692-8000	R. O. Number:	R00653700286039
Tax Status T	Arma	A LE	(620) 662 666	Service Date	Date Printed

OPERATION 2				ag in a
LF14000NNFLG 4965487CUM RX5680039RXCUM CX5680039RXCUM 3688791CUM 4026684CUM RF1135298 3689755CUM 4973532CUM 3678925CUM 3683814CUM 3683607CUM 3957131CUM 4934279CUM 3627695CUM 3684284CUM 4934278CUM 3678762CUM 3678762CUM 3684284CUM 4934278CUM 3678762CUM 3684284CUM 7884-250FX 500010047 RF1135298 K1T-RPL25-20	FILTER CORE-COOLER PUMP, LUBRICATING OIL NUMP, LUBRICATING OIL NOZZLE-PISTON COOLING GASKET, OILISX BRK CLEANER GASKET, LUB OIL CLR HSG GASKET-CORE OIL COOLER O-RING SEAL, O RING SEAL, MOLDE. SEAL, O RIN. *WASHER, SE. SEAL O-RING *WASHER, SE. WASHER, SE. WASHER SEALING SEAL-GROMMET SEAL, O RIN. GASKET AFM DEVICE 4.62 FILTER GASKET, OIL. SEAL, GROMMET ELBOW-RUBB ER SILICONE ROTELLA T510W30 SYTHET BRK CLEANER HARDWARE-RPL CP	1 1 1 1 1 1 2 1 2 2 1 3 6 1 2 2 1 1 1 2 1 1 7 Parts Total Operat	52.84 508.51 617.525 132.85 231.98 2.55 90.29 8.833 2.63 4.42 1.87 4.32 7.54 6.82 3.08 19.65 7.29 52.84 3.17 619.77 19.77 19.77 25.94 Total Ton Ton Ton Ton Ton Ton Ton Ton	52.84 508.51 617.52 132.25 167.10 231.98 5.10 90.266 12.666 5.26 4.42 5.92 7.54 13.64 6.16 19.65 12.05 14.58 3.43 64.70 217.47 59.31 25.94 3,537.79 6,694.22
COMPLAINT: TOWED IN VMRS CODE: 01-999-99				
CORRECTION: TROUBLESH	HOOTING-TOTAL VEHICLE-TO	OTAL VEHICLE	-NO FAILURE	

OI

TOW IN

Labor Total --156.25

SUBLET LABOR TOWING PO#1795295

2,250.00 2,250.00 2,406.25 1 2,250.00
Parts Total --Total Operation 3 ---

CONTINUE



120+ Locations in 19 states, mhc.com

REQUEST FOR PO

SERVICING DEALERSHIP SOUTHWEST STERLING, LLC, DBA

MHC KENWORTH/FORD - EL PASO

10901 GATEWAY WEST EL PASO, TX 79935 1-915-593-2641

QUEST FOR	R PU			 R. O. Number:	R00653700286039
Customer Number:	196976	Phone:	(325) 692-8000	R. O. No.	

- MHC IS CERTIFIED FOR CATERPILLAR, CUMMINS AND MX

 OVERHAULS/WARRANTY REPAIRS

 MHC OFFERS PARTS AND SERVICE FOR ALL MAKES OF TRUCK

 **

* MHC OFFERS PARTS AND SERVICE FOR ALL MAKES OF THOOK	AMOUNT
REPAIR ORDER SUMMARY	3,312.68
Labor Total	3,537.79
Parts Total	2,250.00
Sublet	397.52
Shop Supplies	
	- "

TOTAL DUE

9,497.99

REMIT TO:

P.O. BOX 879269 KANSAS CITY, MO 64187-9269



WELLER









SPICER



JUST

& BorgWarner

